

Manhole Inspection Summary

Manhole # S11EE_025MH

Printed On: 6/24/2010

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **11EE** Node: **025** Status: **Found**

Insp Date: **6/12/08 9:43 AM**

Incomplete Comments

Crew: **RL SD JE**
Inspector: **Lamont**
Firm: **URS**

Location Address: **3038 PRESSTMAN ST**

Cross Street: **N. ROSEDALE ST**

Manhole Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **2** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Flat top**

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **3** Missing: **1** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present


Location View



GRADE ADJUSTMENT

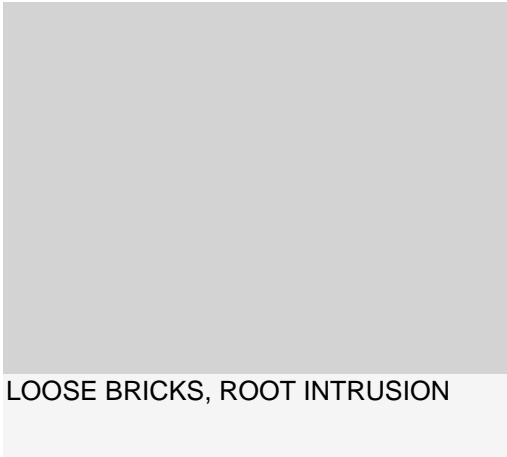


Defect 3

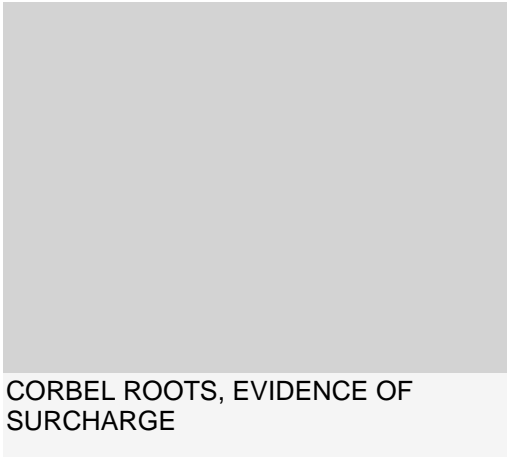

CORBEL ROOTS, EVIDENCE OF SURCHARGE

Top View



ROOT INFILTRATION, EVIDENCE 3' SURCHARGE, DEBRIS ON BENCH, STEPS CORRODED, I STEP MISSING

OFFSET



Defect 1




BARREL ROOTS

Defect 4



BARREL ROOTS

Defect 2



CORBEL ROOTS

Manhole Inspection Summary

Manhole # S11EE_025MH

Printed On: 6/24/2010

Page 4 of 5

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0.5** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S11EE_025MH


Printed On: 6/24/2010

Page 5 of 5

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.40** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection